

1998 Lexus LS400

Submodel: | Engine Type: V8 | Liters: 4.0
Fuel Delivery: FI | Fuel: GAS


DTC	B2797/99	Communication Malfunction No.1
-----	----------	--------------------------------

CIRCUIT DESCRIPTION

This code is detected when although the communication has been performed normally, an error occurs.
(Example. Some noise is in cluded in communication line.)


DTC No.	DTC Detecting Condition	Trouble Area
B2797/99	Communication error	• Wire Harness • Transponder Key Amplifier • ECM

WIRING DIAGRAM

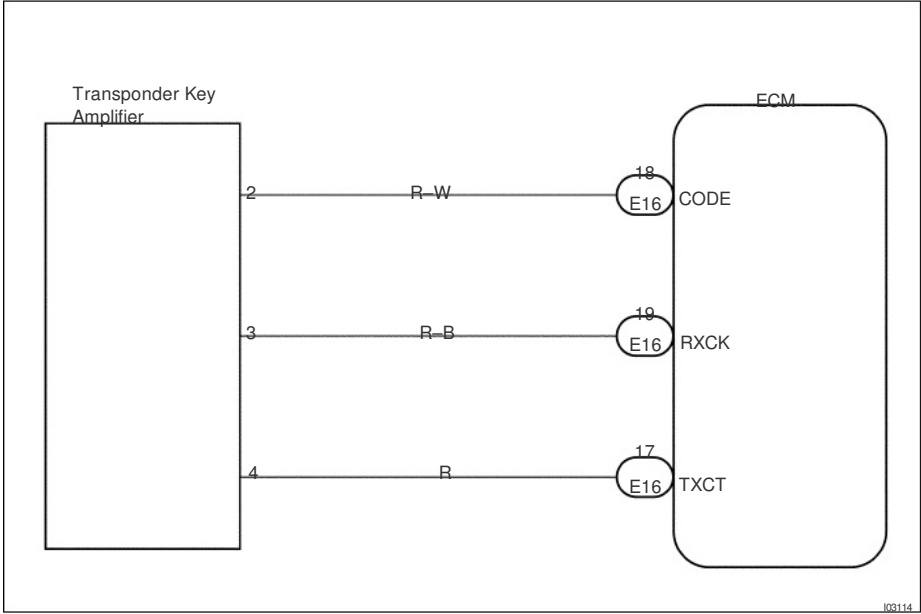

INSPECTION PROCEDURE

1	Noise check
---	-------------

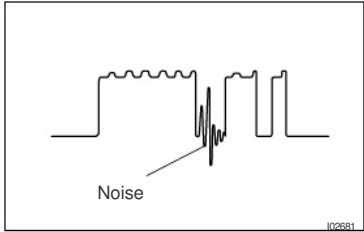

PREPARATION:
Insert already registered master key in the key cylinder.

CHECK:
Using an oscilloscope or LEXUS hand-held tester, check that noise is included in the CODE terminal of EMC.

OK:

No noise is detected.

NG

Try to find the cause of the noise and remove it.

OK

2	Does it operate normally after replacement of transponder key amplifier?
---	--

Yes

Replace transponder key amplifier.

No

Check and replace ECM (See page [IN-30](#)).