

1998 Lexus LS400

Submodel: | Engine Type: V8 | Liters: 4.0
Fuel Delivery: FI | Fuel: GAS


DR7-01

DTC	B2798/99	Communication malfunction No.2
-----	----------	--------------------------------

CIRCUIT DESCRIPTION

DTC No.	DTC Detecting Condition	Trouble Area
B2798/99	Communication error	• Key • Transponder Key Coil • Transponder Key Amplifier • Wire harness • ECM

WIRING DIAGRAM

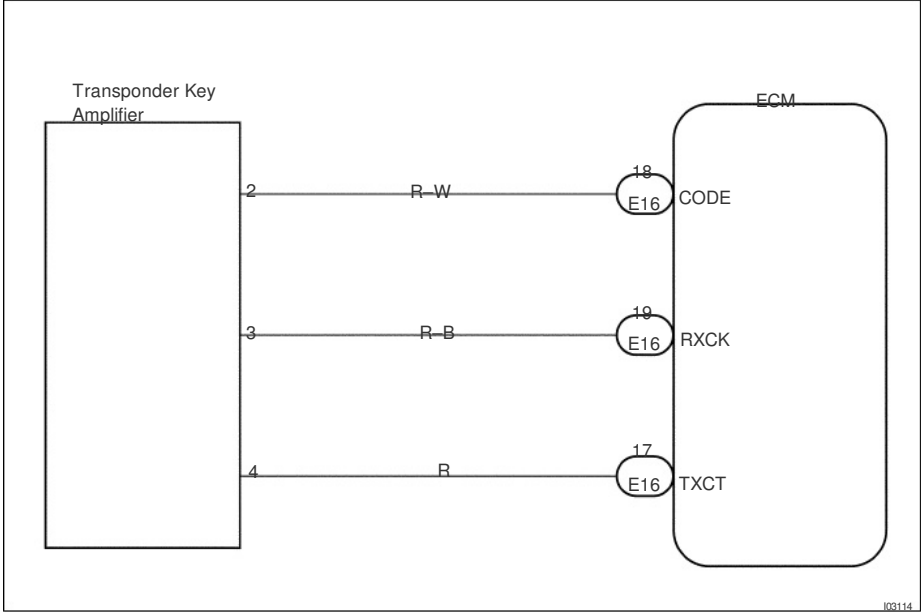

INSPECTION PROCEDURE

1

Check transponder key coil (See page [BE-246](#)).

NG

Replace transponder key coil

OK

2

Check harness and connector between transponder key amplifier and ECM (See page [IN-30](#)).

NG

Repair or replace harness and connector

OK

3

Does it operate normally after replacement of transponder key amplifier?

Yes

Replace transponder key amplifier.

No

Check and replace ECM (See page [IN-30](#)).

