
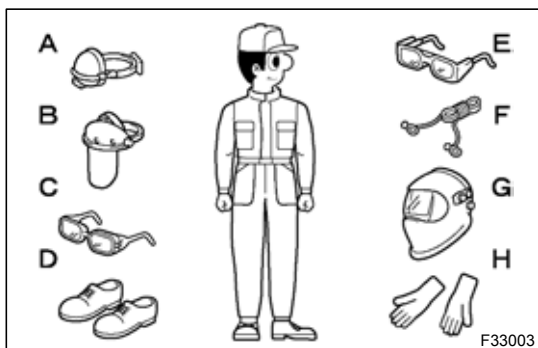
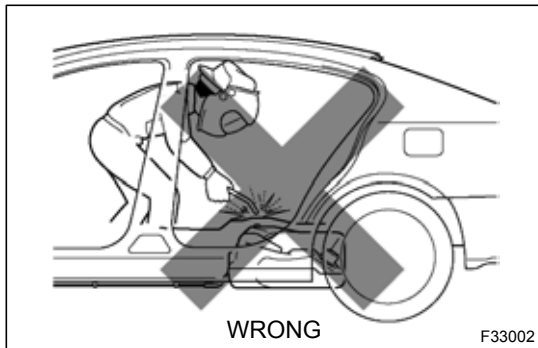
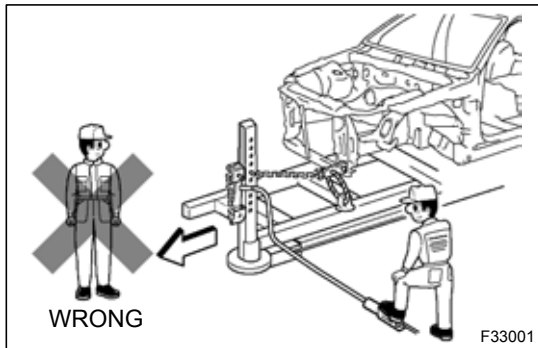


PRECAUTION

1. WORK PRECAUTIONS

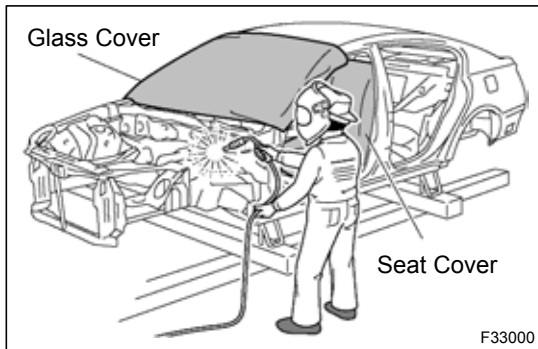

(a) VEHICLE PROTECTION

- (1) When welding, cover glass, seats, carpets, etc. with heat resistant fireproof covers to protect them.

(b) SAFETY

- (1) Never stand in the path of the chain when using a puller on the body or frame, and be sure to attach a safety cable.

- (2) If it is necessary to use a flame in the area of the fuel tank, first remove the tank and plug the fuel line.

(c) SAFETY WORK CLOTHES

- (1) In addition to the usual mechanic's wear, cap and safety shoes, the appropriate gloves, head protector, welder's glasses, ear plugs, face protector, dust mask, etc. should be worn as the situation demands.

Code	Name
A	Dust mask
B	Face protector
C	Safety glasses
D	Safety shoes
E	Welder's glasses
F	Ear plugs
G	Head protector
H	Welder's gloves